



Female High Pressure to Male NPT

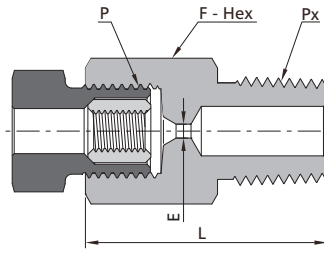

Female High Pressure				Male NPT		
P-Connection	Px-Connection	Ordering Number	Dimensions, in. (mm)			Working Pressure psig (bar)
			L	F	E	
HF4	NS2	SS-FMA-HF4-NS2	1.25 (31.8)	0.75 (19.1)	0.09 (2.4)	15000 (1034)
HF4	NS4	SS-FMA-HF4-NS4	1.37 (34.9)	0.75 (19.1)	0.09 (2.4)	15000 (1034)
HF4	NS6	SS-FMA-HF4-NS6	1.37 (34.9)	0.75 (19.1)	0.09 (2.4)	15000 (1034)
HF4	NS8	SS-FMA-HF4-NS8	1.50 (38.1)	0.87 (22.2)	0.09 (2.4)	15000 (1034)
HF4	NS12	SS-FMA-HF4-NS12	1.75 (44.5)	1.06 (27.0)	0.09 (2.4)	10000 (690)
HF6	NS2	SS-FMA-HF6-NS2	1.50 (38.1)	1.00 (25.4)	0.13 (3.2)	15000 (1034)
HF6	NS4	SS-FMA-HF6-NS4	1.63 (41.3)	1.00 (25.4)	0.13 (3.2)	15000 (1034)
HF6	NS6	SS-FMA-HF6-NS6	1.63 (41.3)	1.00 (25.4)	0.13 (3.2)	15000 (1034)
HF6	NS8	SS-FMA-HF6-NS8	1.75 (44.5)	1.00 (25.4)	0.13 (3.2)	15000 (1034)
HF6	NS12	SS-FMA-HF6-NS12	2.00 (50.8)	1.06 (27.0)	0.13 (3.2)	10000 (690)
HF6	NS16	SS-FMA-HF6-NS16	2.00 (50.8)	1.37 (34.9)	0.13 (3.2)	10000 (690)
HF9	NS2	SS-FMA-HF9-NS2	1.63 (41.3)	1.37 (34.9)	0.19 (4.8)	15000 (1034)
HF9	NS4	SS-FMA-HF9-NS4	1.75 (44.5)	1.37 (34.9)	0.19 (4.8)	15000 (1034)
HF9	NS6	SS-FMA-HF9-NS6	1.75 (44.5)	1.37 (34.9)	0.19 (4.8)	15000 (1034)
HF9	NS8	SS-FMA-HF9-NS8	1.87 (47.6)	1.37 (34.9)	0.19 (4.8)	15000 (1034)
HF9	NS12	SS-FMA-HF9-NS12	2.13 (54.0)	1.37 (34.9)	0.19 (4.8)	10000 (690)
HF9	NS16	SS-FMA-HF9-NS16	2.25 (57.2)	1.37 (34.9)	0.19 (4.8)	10000 (690)

Female High Pressure to Male Type "M"

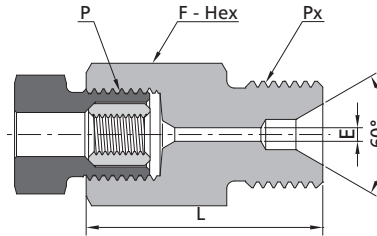

Female High Pressure				Male Type "M"		
P-Connection	Px-Connection	Ordering Number	Dimensions, in. (mm)			Working Pressure psig (bar)
			L	F	E	
HF4	TM9	SS-FMA-HF4-TM9	1.25 (31.8)	0.75 (19.1)	0.09 (2.4)	60000 (4137)
HF4	TM12	SS-FMA-HF4-TM12	1.38 (35.0)	0.75 (19.1)	0.09 (2.4)	30000 (2068)
HF4	TM14	SS-FMA-HF4-TM14	1.56 (39.7)	1.00 (25.4)	0.09 (2.4)	50000 (3447)
HF4	TM16	SS-FMA-HF4-TM16	1.37 (34.9)	1.00 (25.4)	0.09 (2.4)	30000 (2068)
HF6	TM9	SS-FMA-HF6-TM9	1.50 (38.1)	1.00 (25.4)	0.09 (2.4)	60000 (4137)
HF6	TM12	SS-FMA-HF6-TM12	1.63 (41.3)	1.00 (25.4)	0.13 (3.2)	30000 (2068)
HF6	TM14	SS-FMA-HF6-TM14	1.81 (46.0)	1.00 (25.4)	0.13 (3.2)	50000 (3447)
HF6	TM16	SS-FMA-HF6-TM16	1.64 (41.6)	1.00 (25.4)	0.13 (3.2)	30000 (2068)
HF6	TM21	SS-FMA-HF6-TM21	1.56 (39.7)	1.37 (34.9)	0.13 (3.2)	20000 (1379)
HF9	TM14	SS-FMA-HF9-TM14	2.00 (50.8)	1.37 (34.9)	0.15 (3.8)	50000 (3447)
HF9	TM16	SS-FMA-HF9-TM16	1.81 (46.0)	1.37 (34.9)	0.19 (4.8)	30000 (2068)
HF9	TM21	SS-FMA-HF9-TM21	1.81 (46.0)	1.37 (34.9)	0.19 (4.8)	20000 (1379)